
Dwyer. SERIES 477AV **HANDHELD DIGITAL MANOMETER** Measures Pressure, Flow and Velocity; $\pm 0.5\%$ Accuracy





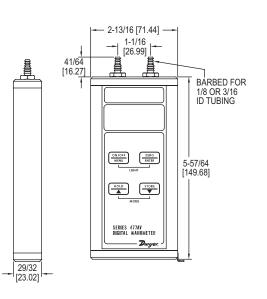

The Series 477AV Handheld Digital Manometer is now available with pressure, flow, and velocity measurements along with a number of other convenient features. The built-in air velocity and flow calculations provide accuracy and conserve time and error associated with manual calculations. Also featured on this unit are adjustable zero and span values for calibrating in the field, as well as a damping feature to compensate for the fluctuating of readings.

FEATURES/BENEFITS

- · Calculates and displays air velocity and volumetric air flow
- · Rugged aluminum case protects instrument from damage during transport/use
- · 9 selectable English and metric engineering units
- · Large, easy to read display with backlight for use in dark areas
- · Stores up to 40 readings with minimum, maximum and average statistics

APPLICATIONS

- · Air flow monitoring
- · Duct static pressure

SPECIFICATIONS	
Service: Air and compatible gases.	Units of Pressure: in w.c., ft w.c., in Hg,
Wetted Materials: Consult factory.	psi, oz/in², mm w.c., cm w.c., mm Hg,
Accuracy: ±0.5% FS, 60 to 78°F (15.6	mbar, Pa, kPa, hPa.
to 25.6°C); ±1.5% FS from 32 to 60°F	Units of Velocity: fpm, fps, mph, m/h,
and 78 to 104°F (0 to 15.6°C and 25.6	m/s, k/h, knot.
to 40.0°C).	Units of Flow: cfm, m ³ /h, m ³ /s.
Pressure Hysteresis: ±0.1% FS.	Power Requirements: 9 V alkaline
Pressure Limits: See chart.	battery, installed non-functional, user
Temperature Limits: 0 to 140°F (-17.8	replaceable.
to 60°C).	Weight: 10.2 oz (289 g).
Compensated Temperature Limits: 32	Process Connections: Two barbed
to 104°F (0 to 40°C).	connections for use with 1/8" (3.18
Storage Temperature Limits: -4 to	mm) or 3/16" (4.76 mm) ID tubing. Two
176°F (-20 to 80°C).	compression fittings for use with 1/8"
Display: 0.42" (10.6 mm) 4 digit LCD.	(3.18 mm) ID x 1/4" (6.35 mm) OD tubing
Resolution: See chart.	for 477AV-7 and 477AV-8 only.
	Agency Approvals: CE.

MODEL CHART																
	Pressure	Velocit	y Range	Available Pressure Units										Maximum		
Model	Range	fpm	m/s	psi	in Hg	kPa	in w.c.	mm Hg	mbar	mm w.c.	Ра	ft w.c.	oz/in ²	hPa	cm w.c.	Pressure
477AV-000	0 to 1.000 in w.c.	4004	20.34	-	0.0736	0.2491	1.000	1.868	2.491	25.40	249.1	0.0833	0.5780	2.491	2.540	5 psig
477AV-00	0 to 4.000 in w.c.	8009	40.69	0.1445	0.2942	0.996	4.000	7.473	9.96	101.6	996	0.3333	2.312	9.964	10.16	5 psig
477AV-0	0 to 10.00 in w.c.	1.266k	64.33	0.3613	0.7355	2.491	10.00	18.68	24.91	254.0	2491	0.8333	5.780	24.91	25.40	5 psig
477AV-1	0 to 20.00 in w.c.	1.791k	90.97	0.7225	1.471	4.982	20.00	37.36	49.82	508.0	4982	1.667	11.56	49.82	50.80	10 psig
477AV-2	0 to 40.00 in w.c.	25.33k	128.7	1.445	2.942	9.96	40.00	74.73	99.6	1016	9964	3.333	23.12	99.64	101.6	10 psig
477AV-3	0 to 200.0 in w.c.	56.63k	287.7	7.225	14.71	49.82	200.0	373.6	498.2	5080	-	16.67	115.6	498.2	508.0	30 psig
477AV-4	0 to 10.00 psi	66.62k	338.4	10.00	20.36	68.95	276.8	517.1	689.5	7031	-	13.07	160.0	689.5	703.1	30 psig
477AV-5	0 to 20.00 psi	94.22k	478.6	20.00	40.72	137.9	553.6	1034	1379	-	-	46.13	320.0	1379	1406	60 psig
477AV-6	0 to 30.00 psi	115.4k	586.2	30.00	61.08	206.9	830.4	1551	2069	-	-	69.20	480.0	2068	2109	60 psig
477AV-7	0 to 100.0 psi	210.7k	1070	100.0	203.6	689.5	2768	5171	6895	-	-	230.7	1600	6895	7031	150 psig
477AV-8	0 to 150.0 psi	258.0k	1311	150.0	305.4	1034	4152	7757	-	-	-	346.0	2400	-	-	200 psig

OPTIONS			
To order add suffix:	Description		
-NIST	NIST traceable calibration certificate		
Example: 477AV-1-NIST			

ACCESSORIES				
Model	Description			
	Carrying case; tough gray nylon pouch protects any Series 477AV Manometer; double zippered for quick and easy access, with a belt loop that snaps closed; 7-1/2"H x 3"W x 2-1/4"D (191 x 76 x 57 mm)			
UHH-C1	Soft carrying case			
A-47X-BOOT	Protective magnetic rubber boot			



A-402A



UHH-C1



A-47X-BOOT (Manometer not included)